




Referencia	Enchufe Rápido Hembra Rosca	SW	L	L1	D
RNN 3210	G 1/8"	14	38	9	16
RNN 3214	G 1/4"	17	38	9	16
RNN 3218	G 3/8"	19	38	9	16
RNN 3219	M 12 x 1,5	17	38	9	16

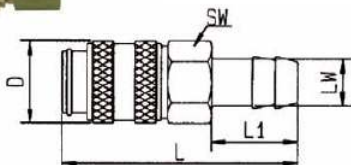

Referencia	Enchufe Rápido con Espiga de	SW	L	L1	D
RNN 3224	4 mm.	14	45	17	16
RNN 3225	5 mm.	14	45	17	16
RNN 3226	6 mm.	14	45	17	16
RNN 3228	8 mm.	14	45	17	16
RNN 3229	9 mm.	14	45	17	16
RNN 3230	10 mm.	14	45	17	16

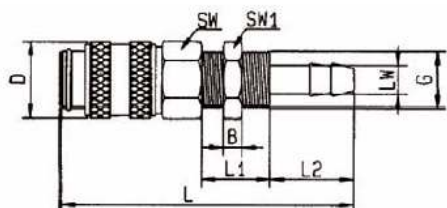

Referencia	Enchufe Rápido Pasamuros Espiga	SW	L	L1	D
RNN 3254	4 mm.	14	60	16	
RNN 3255	5 mm.	14	60	16	
RNN 3256	6 mm.	17	60	16	
RNN 3258	8 mm.	17	60	16	
RNN 3259	10mm.	17	60	16	

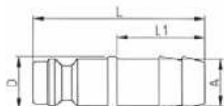


Referencia	Espiga Enchufe Rápido de		L	L1	D
RNN 3304	4 mm.		32	17	9
RNN 3306	6 mm.		32	17	9
RNN 3308	8 mm.		32	17	9
RNN 3309	9 mm.		32	17	9
RNN 3309-10	10 mm.		32	17	9



Referencia	Espiga Enchufe Rápido con alivio		L	D
RNN 3294	Tubo de 4x6		120	16
RNN 3296	Tubo de 6x8		120	16



Referencia	Espiga Enchufe Rápido R. Macho	SW		L1	D
RNN 3310	G 1/8"	14		25	7
RNN 3314	G 1/4"	17		27	9
RNN 3318	G 3/8"	19		27	9

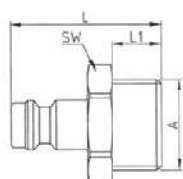

Referencia	Espiga Enchufe Rápido R. Hembra	SW		L1	D
RNN 3321	G 1/8"	14		25	7
RNN 3324	G 1/4"	17		27	9
RNN 3328	G 3/8"	19		26	10
RNN 3330	M 10 x Izqda.	14		24	10
RNN 3333	G 3/8" Izqda.	19		26	10